

### Features & Benefits

- 💧 Cures in shadow areas
- 💧 Good adhesion to metals and plastics
- 💧 Tack-free in seconds using UV torch (flashlight)
- 💧 Reduced odour, reduced bloom
- 💧 Good open time for accurate alignment
- 💧 Transparent in a thin layer
- 💧 Excellent environmental resistance
- 💧 Low hazard SDS

### Description

PERMABOND® 130UV is a low-viscosity, solvent-free, light cure cyanoacrylate adhesive that fluoresces under UV light. It is developed for applications where fast bonding between opaque substrates and tack-free fillets are needed. The UV light cure facilitates the curing, minimising the blooming effect, and allowing rapid bonding through transparent parts. When used as a UV-curable adhesive or coating, the moisture cure provides polymerisation in small shadow areas.

### Physical Properties of Uncured Adhesive

Chemical composition	Ethyl cyanoacrylate
Appearance	Yellow before cure Clear in a thin bondline
Viscosity @ 25°C	200 mPa.s (cP)
Specific gravity	1.1

### Typical Curing Properties

Open time (moisture cure only [22°C/50% RH])	NBR 3s EPDM 20s Stainless steel 30s Mild steel 30s Aluminum 30s Nylon 6 20s ABS 10s PC 40s PMMA 80s PETG 55s
Tack free time (UV cure)* Spot LED, 150 mW/cm <sup>2</sup> , 405nm Spot LED, 25mW/cm <sup>2</sup> , 405nm	≤1s ≤5s


\*The time depends on the power of the UV lamp, its spectral output, the distance between the lamp and the components..

### Typical Performance of Cured Adhesive

Shear strength*	Abraded mild steel 12-17 N/mm <sup>2</sup> (1740 psi – 2465 psi) Stainless steel 14-19 N/mm <sup>2</sup> (2030 psi – 2755 psi) Aluminium 5-9 N/mm <sup>2</sup> (725 psi – 1305 psi) Polycarbonate 6-10 N/mm <sup>2</sup> (870 psi – 1450 psi) PMMA 7-11 N/mm <sup>2</sup> (1015 psi – 1595 psi) PA6 7-11 N/mm <sup>2</sup> (1015 psi – 1595 psi) PVC 8-12 N/mm <sup>2</sup> (1160 psi – 1740 psi) ABS 6-10 N/mm <sup>2</sup> (870 psi – 1450 psi)
Hardness (ISO868)	70-80 Shore D

\* 24 hour moisture cure only. Higher strengths can be obtained on clear substrates using UV light secondary cure. Strength results will vary depending on the level of surface preparation and gap.

### Depth of Cure

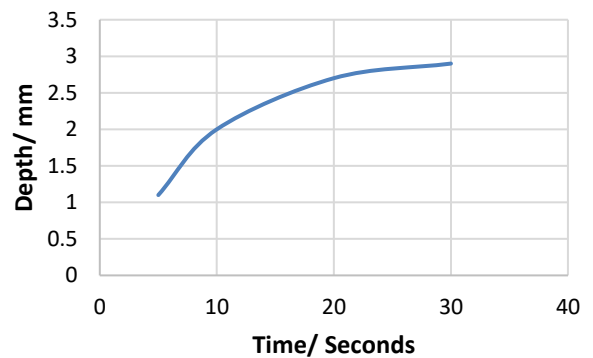

Graph shows the depth of cure at 25 mW/cm<sup>2</sup> and 405nm. The depth of cure will depend on the power of the UV lamp, its spectral output, the distance between the lamp and the adhesive.

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.

## Additional Information

This product is not recommended for use in contact with strong oxidizing materials.

Information regarding the safe handling of this material may be obtained from the Safety Data Sheet.

Users are reminded that all materials, whether innocuous or not, should be handled in accordance with the principles of good industrial hygiene.

**This Technical Datasheet (TDS) offers guideline information and does not constitute a specification.**

## Surface Preparation

Surfaces should be clean, dry and grease-free before applying the adhesive. Particular care should be taken to remove silicone based cleaning agents which may have been used previously to clean glass.

Some metals such as aluminium, copper and its alloys, will benefit from light abrasion with emery cloth (or similar) to remove the oxide layer.

Isopropanol can be used to degrease most surfaces.

Where thermoplastic surfaces are involved we recommend tests are done to ensure compatibility, mold release agents may affect bond strength.

## Directions for Use

- 1) Adhesive can either be applied directly from the bottle or dispensed via automated dispensing equipment for more accurate dosing. Apply the adhesive sparingly to one surface. Minimise exposure of product to ambient light.
- 2) Bring the components together quickly and correctly aligned. It is important to try to prevent air entrapment within the joint as this could be detrimental to the finished appearance of the adhesive.
- 3) Apply sufficient pressure to ensure the adhesive spreads into a thin film. Parts should be firmly held and not disturbed during cure. Expose the joint to ultra-violet light for the appropriate time to ensure full cure. Cure time depends on the power of the UV lamp, its spectral output, the distance between the lamp and the components, and the transmission characteristics of the substrates.
- 4) For help selecting a suitable lamp and/or dispensing equipment, please contact the Permabond technical helpline.

## Other Products Available

### Anaerobics

- Thread lockers
- Thread sealants
- Gasket makers
- Sealants / retainers

### Cyanoacrylates

- Instant adhesives
- For rapid bonding of metals, plastics, rubber and many other materials

### Epoxies

- Two-part room temperature cure adhesives
  - Single-part heat cure adhesives
- Modified Technology (MT) flexible grades available

### MS-Polymers

- Single-part, moisture-curing, flexible sealants

### Polyurethanes

- Two-part room temperature curing adhesives

### Toughened Acrylics

- Rapid curing, high strength structural adhesives

### UV Light Cured Adhesives

- Glass / plastic bonding
  - Optically clear
  - Non-yellowing

## Storage & Handling

Storage Temperature	2 to 7°C (35 to 45°F)
Protect liquid adhesive from room lighting.	

[www.permabond.com](http://www.permabond.com)

- UK: 0800 975 9800
- General Enquiries: +44 (0)1962 711661
- US: 732-868-1372
- Asia: + 86 21 5773 4913

[info.europe@permabond.com](mailto:info.europe@permabond.com)

[info.americas@permabond.com](mailto:info.americas@permabond.com)

[info.asia@permabond.com](mailto:info.asia@permabond.com)

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.